HIGH-PERFORMANCE THIN FILM PRESSURE TRANSDUCER STANDARD AND METRIC UNITS

Twist-lock style.

MILLIVOLT OUTPUT PRESSURE TRANSDUCERS

mV/V Output 0-15 to 0-10,000 psi-Standard Models 0-1 to 0-600 bar Metric Models

PX5500L1-100GV, shown actual size.

PX5500/PXM5500 Series



- ✓ High Accuracy: 0.1%
- Solid State Reliability
- Sputtered Strain Gage Design
- High Shock and Vibration Resistance
- 🛩 Low Drift
- 5-Point NIST Calibration Standard

Applications

- Testing
- R&D/Engineering Test Laboratories
- Functional Test Systems
- Production Testing
- Product Quality Assurance
- Flight Testing
- Gas Turbine and Engine Test Standards
- Ground Support Equipment
- ✓ Hydraulic Systems
- Custody Transfer Measurements

OMEGA's PX5500/PXM5500 Series transducers provide high performance in demanding industrial and research applications in which accuracy, reliability, and price are important. These transducers have a 10-year MTBF rate and are stable to 0.1% of FSO over an 18-month period. This translates into less downtime, fewer test reruns, more time between calibrations, and high confidence in pressure data. When recalibration is impossible, relying

on the high stability of a PX5500/ PXM5500 Series transducers may be the only cost-effective way to obtain pressure data over the long term. OMEGA's thin-film technology makes this premium performance possible. The strain gages and associated structures are sputter-deposited directly onto the pressure sensing element, thus eliminating the need for adhesives. The resulting molecular bond between the sensing element and the strain gages ensures virtually no shifting, drifting, or "creep" in the performance of the transducer. The micro-geometry design of the PX5500/PXM5500 sensing elements results in a very small, low-mass sensor that reduces effects of mechanical vibration and shock. The PX5500/PXM5500 gives you accuracy, reliability, and stability at competitive prices.

SPECIFICATIONS mV/V MODELS

Excitation: 10 Vdc

Output FSO: 30 mV typ, 26 mV min Input Resistance: 2500 Ω typical, 800 Ω min, 3000 Ω max. For 350 Ω bridge models see Custom

Configurations. **Output Resistance:** 2500 Ω typical, 800 Ω minimum, 3300 Ω maximum

Insulation Resistance: $500M\Omega$ at 50Vdc over the compensated range

Sensing Element: 4-active-arm bridge using sputter-deposited thin-film elements

Accuracy: Combined linearity, hysteresis and nonrepeatability: ±0.10% FSO (BFSL) <1000 psi ±0.15% FSO 1000 psi and above Calibration Stability: ±0.1% for 18 months

Vibration Sensitivity: At 35 g peak sinusoidal vibration from 10 Hz to 2000 Hz (½" D.A.), the output shall not exceed 0.04% FSO/g for 15 psi range, decreasing to 0.003% FSO/g for 1000 psi and above

Natural Frequency: 5 kHz for 15 psi, increasing logarithmically to 50 kHz for 5000 psi Shock: Qualification level of 100 g, 11 ms half sine wave without damage Electrostatic Discharge (ESD): Protected to 15 kV

Operating Temp Range: -54 to 150°C (-65 to 300°F) Compensated Temp Range:

- -18 to 82°C (0 to 180°F) Thermal Effects:
- Span: ±0.0025% FSO/°F Zero: ±0.0025% FSO/°F

Proof Pressure:


2 times rated pressure or 15,000 psi, whichever is less, will not cause changes in performance beyond the specified tolerance

Burst Pressure: 3 times rated pressure or 20,000 psi, whichever is less, will not cause rupture of the pressure containment cavity Wetted Parts:

17-4 PH or 15-5 PH SS

Electrical Connection: PTIH-10-6P standard – see custom configurations Pressure Port: See drawing below Mating Connector:

PTS06A10-6S-R (sold separately) Weight: 200 g (7 oz) maximum

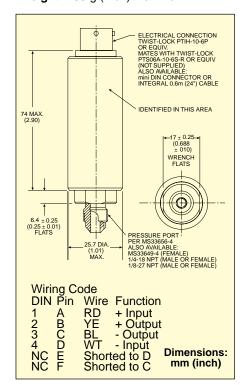

HIGH-PERFORMANCE THIN FILM PRESSURE TRANSDUCER


STANDARD CUSTOM CONFIGURATIONS

	PORT CON	CTRICAL INECTION [2]	RANGE	UNITS [4]	OUTPUT	OPTIONS
B = ¹ / ₈ -27 C = ¹ / ₄ -18	V NPT Male V NPT Female NPT Male NPT Female 3656-4 33649-4 0 = 0.6 m (2' cost per) cable add /ft over 0.6 m (2') -6P connector). Mating or (sold ly), order -10-6S-R	015 psi 025 050 100 250 500 1K 1.5K 2.5K 3K 5K 10K	A, A	Base Price PX5500 V = mV/V 5T = 0 to 5V I = 4 to 20mA To order a custor 1. Select a pressur 2. Select electrical 3. Select a pressur 4. Select pressure Gage or Sealed 5. Select output	CAL11 = 11-pt cal + cost m configuration: re port connection re range units – Absolute,

Comes complete with 5-point calibration.

Ordering Examples: PX5503A1-015AV, 350 Ω bridge, 1/2-27 NPT male pressure port, PTIH-10-6P style connector, 15 psi absolute pressure range and mV/V output.

PTS06A-10-6S-R, mating connector (sold separately). PX5500M1-10KG5T, MS33649-4 female pressure port, PTIH-10-6P style connector, 10,000 psi gage pressure range and 0 to 5 Vdc output. PTS06A-10-6S-R, mating connector (sold separately). PX5500L0-015AI-25FT, MS33656-4 male pressure port, 8 m (25') lead wire, 15 psi absolute pressure range and 4 to 20 mA output.



METRIC PSI RANGE CUSTOM CONFIGURATIONS

PXM5500 PRESSURE PORT ELECTRICAL CONNECTION [1] [2] MA = G½B Male cost MB = G½B Female no charge MC = G½B Male cost MD = G½B Female no charge Image: Delta del	RANGE (BAR) [3] 1.0 1.6 4.0 6.0 10 10 16	UNITS [4] (, SS (, SS (, SS (, SS (, SS (, SS (, SS (, SS (, SS) (, SS)	OUTPUT [5] I = 4 to 20 mA Base price PXM5500	OPTIONS [6] CAL11 = 11-point calibration certificate ()m = Optional cable length in meters
add cost per/m over 0.2 m (2') 1 = PTIH-10-6P connector (or equal, no charge) 6 = mini DIN connector Visit us online for additional options inclu	16 25 40 60 100 160 250 400 600 uding	Â, ĜĠĠĠŎġŎġ Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă, Ă,	 Select a p Select ele Select a p Select pre 	custom configuration: pressure port ectrical connection pressure range essure units – Absolute, Sealed gage tput
extended compensated temperatures.	aanig		6. Select op	tions and agency approvals

Ordering Examples: PXM5500MB0-010BARS5T, 10 bar sealed gage pressure transducer with G1₆B female connection and 0.6 m (2') cable termination.

PXM5500MD1-010BARA5T, 10 bar absolute pressure transducer with G¹/₄ **PTS06A-10-6S-R,** mating connector (sold separately).

B female connection and twist-lock connector.

STANDARD MODELS

		STANDARD N	IODELS			
		To Order				
		Models with m	V/V Output, M	S33656-4 Connectior	n, Integral Connector	
		RANGE		MODEL NO.	COMPATIBLE METERS*	
		ABSOLUTE PF	RESSURE (All	Ranges Available in .	Absolute Pressure)	
		0 to 15 psi	0 to 1.0 bar	PX5500L1-015AV	DP41-S, DP25B-S	
91	Twist-lock	0 to 25 psi	0 to 1.7 bar	PX5500L1-025AV	DP41-S, DP25B-S	
	style.	0 to 50 psi	0 to 3.4 bar	PX5500L1-050AV	DP41-S, DP25B-S	
		0 to 100 psi	0 to 6.9 bar	PX5500L1-100AV	DP41-S, DP25B-S	
1 11		GAGE PRESS	URE (All Rang	es also Available in S	Sealed Gage Pressure)	
1 11		0 to 15 psi	0 to 1.0 bar	PX5500L1-015GV	DP41-S, DP25B-S	
111		0 to 25 psi	0 to 1.7 bar	PX5500L1-025GV	DP41-S, DP25B-S	
		0 to 50 psi	0 to 3.4 bar	PX5500L1-050GV	DP41-S, DP25B-S	
		0 to 100 psi	0 to 6.9 bar	PX5500L1-100GV	DP41-S, DP25B-S	
		0 to 250 psi	0 to 17.2 bar	PX5500L1-250GV	DP41-S, DP25B-S	ġ
		0 to 500 psi	0 to 34.5 bar	PX5500L1-500GV	DP41-S, DP25B-S	
		0 to 1000 psi	0 to 68.9 bar	PX5500L1-1KGV	DP41-S, DP25B-S	
STANDA		0 to 1500 psi	0 to 103 bar	PX5500L1-1.5KGV	DP41-S, DP25B-S	
	.1-100GV, ctual size.	0 to 2500 psi	0 to 172 bar	PX5500L1-2.5KGV	DP41-S, DP25B-S	
37		0 to 3000 psi	0 to 207 bar	PX5500L1-3KGV	DP41-S, DP25B-S	
		0 to 5000 psi	0 to 345 bar	PX5500L1-5KGV	DP41-S, DP25B-S	
		0 to 10,000 psi	0 to 689 bar	PX5500L1-10KGV	DP41-S, DP25B-S	
		Comes complete	with 5-point calibr	ration. * Vis	sit us online for compatible meters.	'

Comes complete with 5-point calibration. * Visit us online for compatible meters. To order absolute pressure models, replace "G" in model number with "A". No extra charge. To order sealed gage models, replace "G" in model number with "S". No extra charge. Ordering Examples: PX5500L1-1KSV, 1000 psi sealed gage transducer with PTIH-10-6P electrical connection and MS33656-4 male pressure port. PTS06A-10-6S-R, mating connector (sold separately).

PX5500L1-100AV, 100 psi absolute pressure transducer with PTIH-10-6P electrical connection and **MS33656-4** male pressure port. **PTS06A-10-6S-R**, mating connector (sold separately).

METRIC MODELS

To Order						
Models with G ¼ Male Pressure Connection, Cable or mini DIN and mV/V Output						
RANGE		MODEL NO.	COMPATIBLE METERS*			
GAGE PRE	SSURE					
0 to 1 bar	0 to 15 psi	PXM5500MC[*]-001BARGV	DP41-S, DP25B-S			
0 to 1.60 bar	0 to 23 psi	PXM5500MC[*]-1.60BARGV	DP41-S, DP25B-S			
0 to 4 bar	0 to 58 psi	PXM5500MC[*]-004BARGV	DP41-S, DP25B-S			
0 to 6 bar	0 to 87 psi	PXM5500MC[*]-006BARGV	DP41-S, DP25B-S			
0 to 10 bar	0 to 145 psi	PXM5500MC[*]-010BARGV	DP41-S, DP25B-S			
0 to 16 bar	0 to 232 psi	PXM5500MC[*]-016BARGV	DP41-S, DP25B-S			
0 to 25 bar	0 to 363 psi	PXM5500MC[*]-025BARGV	DP41-S, DP25B-S			
0 to 40 bar	0 to 580 psi	PXM5500MC[*]-040BARGV	DP41-S, DP25B-S			
0 to 60 bar	0 to 870 psi	PXM5500MC[*]-060BARGV	DP41-S, DP25B-S			
0 to 100 bar	0 to 1450 psi	PXM5500MC[*]-100BARGV	DP41-S, DP25B-S			
0 to 160 bar	0 to 2321 psi	PXM5500MC[*]-160BARGV	DP41-S, DP25B-S			
0 to 250 bar	0 to 3626 psi	PXM5500MC[*]-250BARGV	DP41-S, DP25B-S			
0 to 400 bar	0 to 5802 psi	PXM5500MC[*]-400BARGV	DP41-S, DP25B-S			
0 to 600 bar	0 to 8702 psi	PXM5500MC[*]-600BARGV	DP41-S, DP25B-S			

Comes complete with 5-point NIST-traceable calibration.

* Visit us online for compatible meters.

[*] = Insert "0" for 0.6 m (2') cable "1" for twist-lock connector for "6" for mini DIN connector. To order absolute pressure models, replace "G" in model number with "A" (no extra charge). To order sealed gage models, replace "G" in model number with "S" (no extra charge). Ordering Example: PXM5500MC6-60BARSV, mV/V output, 60 bar sealed gage transducer with mini DIN connector and G ¼ male pressure port. Mating connector included.

ACCESSORY

mini DIN style.

MODEL NO.	DESCRIPTION
PTS06A-10-6S-R	Mating connector for PX5500/PXM5500 units with PTIH-10-6P electrical connection

High-Performance Thin Film Pressure Transducer Imperial and Metric Models

0-5 and 0-10 Vdc Output Models 3 Wire Amplifier 0-15 to 0-10.000 psi-Imperial Models

0-1 to 0-600 bar-Metric Models 1 bar = 14.5 psi

 $1 \text{ kg/cm}^2 = 14.22 \text{ psi}$ 1 atmosphere = 14.7 psi = 29.93inHg = 760.2 mmHg = 1.014 bar

PX5500/ PXM5500 Series



- Integral Shunt Calibration
- ✓ Low Noise, 5 Vdc and **10 Vdc Output Models**
- ✓ High 0.1% Accuracy
- Solid State Reliability
- Sputtered Strain Gage Design
- High Shock and Vibration Resistance
- Low Drift

Applications

- R&D/Engineering Test Laboratories
- Functional Test Systems
- Production Testing
- Flight Testing
- Gas Turbine and Engine **Test Stands**
- Hydraulic Systems
- Custody Transfer Measurements

OMEGA'S PX5500/PXM5500 transducer series provides high performance in demanding industrial and research applications where accuracy, reliability, and price are important. These transducers have a 10-year MTBF rate and are stable to 0.1% of FSO over an 18-month period. This translates into less downtime, fewer test reruns, more time between calibrations, and high confidence in your pressure data. When recalibration is impossible, relying on the high stability of the PX5500/ PXM5500 Series transducers may be the only cost-effective way to obtain pressure data over the long term. OMEGA's thin-film technology makes this premium performance possible. The strain gages and

associated parts are sputterdeposited directly onto the pressure sensing element, eliminating the need for adhesives. The resulting molecular bond between the sensing element and the strain gage ensures virtually no shifting, drifting, or "creep" in the performance of the transducer. The micro-geometry design of the PX5500/PXM5500 sensing element affords a very small, low-mass sensor that reduces effects of mechanical vibration and shock. The PX5500/PXM5500 gives you accuracy, reliability, and stability at competitive prices.

Specifications

Electrical Connection: See Custom Configurations Pressure Port: See Custom Configurations

Mating Connector (Style 1): PT06F10-6S-R (sold separately) Weight: 225 g (8 oz) max Excitation: 16 to 38 Vdc unregulated Output (FS) 5E/5T Models: 5 Vdc ±0.1 Vdc ±10% adj Output (FS) 10E Models: 10 Vdc ±0.1 Vdc ±10% adj **CE Compliant:** Meets industrial emissions and immunity to EN61326

Zero Balance: 0 Vdc ±0.1 Vdc ±5% adj Input Current: 20 mA max with no load

Output Resistance: 100 Ω max **Insulation Resistance:** 100MΩ at 50Vdc between all pins shorted

together and case

Electrostatic Discharge: Protected to 15 kV max Sensing Element:

4-active-arm bridge using sputterdeposited thin-film elements

Accuracy: Combined linearity, hysteresis and repeatability: ±0.10% FS (BFSL) <70 bar (<1000 psi) ±0.15% FS 70 bar (1000 psi) and above

Natural Frequency: 5 kHz for 1 bar (15 psi), increasing logarithmically to 50 kHz for 5000 psi

IMPERIAL PX5500L1-100G5E, shown actual size.

Fwist-lock

style.

Operating Temp Range: -54 to 121°C (-65 to 250°F)

Compensated Temp Range:


-18 to 82°C (0 to 180°F) Thermal Effects (Over the

Compensated Range): Span: ±0.015% FS/°F (0.027%/°C) Zero: ±0.015% FS/°F (0.027%/°C)

Proof Pressure: 2 times rated pressure or 1000 bar (15,000 psi), whichever is less, will not cause changes in performance beyond the specified tolerance

Burst Pressure: 3 times rated pressure or 1300 bar (20,000 psi), whichever is less, will not cause rupture of the pressure containment cavity Wetted Parts:

17-4 PH or 15-5 PH stainless steel

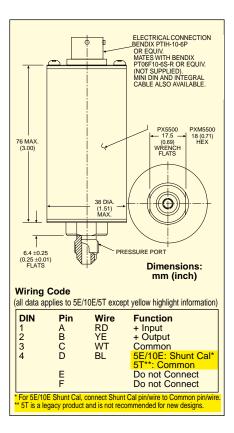

High-Performance Thin-Film Pressure Transducer

Imperial Custom Configurations

SERIES PORT CON	CTRICAL NECTION RANGE 2] – [3]	UNITS [4]	OUTPUT [5]	OPTIONS [6]
charge). (sold sepa PT06F10	per/foot 1.5K n (2') 2.5K P twist-lock 3K P twist-lock 5K (or equal, no 5K Mating connector 10K Irately), order 6S-R onnector (no charge) 0 otions including 0	S,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A S,G,G,A	10E = 0 to 10 Vdc 5T* = 0 to 5 Vdc * 5T is a legacy product and is not recommended for new designs. To order a cus 1. Select a pre 2. Select electri 3. Select a pre	rical connection ssure range sure units – Sealed Gage, solute it

To Order

Popular Imperial Models with 0 to 5 or 0 to 10 Vdc Output Shown Below (See Custom Configurations Section for All Available Versions/Options)

Pressur	e Range	Model No. (With Output Termination Style)				
Imperial	Metric	0.6 m (2') Cable	PTIH-10-6P Connector	mini DIN Connector		
Absolute Press	sure (All Ranges	Available in Absolute	Pressure, See Custom C	Configurations Section)		
0 to 15 psi	0 to 1.0 bar	PX5500[*]0-015A[**]	PX5500[*]1-015A[**]	PX5500[*]6-015A[**]		
0 to 25 psi	0 to 1.7 bar	PX5500[*]0-025A[**]	PX5500[*]1-025A[**]	PX5500[*]6-025A[**]		
0 to 50 psi	0 to 3.4 bar	PX5500[*]0-050A[**]	PX5500[*]1-050A[**]	PX5500[*]6-050A[**]		
0 to 100 psi	0 to 6.9 bar	PX5500[*]0-100A[**]	PX5500[*]1-100A[**]	PX5500[*]6-100A[**]		
Gage Pressure	(All Ranges Als	so Available in Sealed G	age Pressure, See Belo	w)		
0 to 15 psi	0 to 1.0 bar	PX5500[*]0-015G[**]	PX5500[*]1-015G[**]	PX5500[*]6-015G[**]		
0 to 25 psi	0 to 1.7 bar	PX5500[*]0-025G[**]	PX5500[*]1-025G[**]	PX5500[*]6-025G[**]		
0 to 50 psi	0 to 3.4 bar	PX5500[*]0-050G[**]	PX5500[*]1-050G[**]	PX5500[*]6-050G[**]		
0 to 100 psi	0 to 6.9 bar	PX5500[*]0-100G[**]	PX5500[*]1-100G[**]	PX5500[*]6-100G[**]		
0 to 250 psi	0 to 17.2 bar	PX5500[*]0-250G[**]	PX5500[*]1-250G[**]	PX5500[*]6-250G[**]		
0 to 500 psi	0 to 34.5 bar	PX5500[*]0-500G[**]	PX5500[*]1-500G[**]	PX5500[*]6-500G[**]		
0 to 1000 psi	0 to 68.9 bar	PX5500[*]0-1KG[**]	PX5500[*]1-1KG[**]	PX5500[*]6-1KG[**]		
0 to 1500 psi	0 to 103 bar	PX5500[*]0-1.5KG[**]	PX5500[*]1-1.5KG[**]	PX5500[*]6-1.5KG[**]		
0 to 2500 psi	0 to 172 bar	PX5500[*]0-2.5KG[**]	PX5500[*]1-2.5KG[**]	PX5500[*]6-2.5KG[**]		
0 to 3000 psi	0 to 207 bar	PX5500[*]0-3KG[**]	PX5500[*]1-3KG[**]	PX5500[*]6-3KG[**]		
0 to 5000 psi	0 to 345 bar	PX5500[*]0-5KG[**]	PX5500[*]1-5KG[**]	PX5500[*]6-5KG[**]		
0 to 10,000 psi	0 to 689 bar	PX5500[*]0-10KG[**]	PX5500[*]1-10KG[**]	PX5500[*]6-10KG[**]		

Comes complete with 5-point NIST-traceable calibration. Visit us online for compatible meters.

[*] Pressure Port (see Custom Configurations section and enter A, B, C, D, L, or M).

[**] Output Voltage Range: Enter "5E" for 0 to 5 Vdc output, or "10E" for 0 to 10 Vdc output.

To order absolute pressure transducers, change "G" in model number to "A" (no extra charge). To order sealed gage transducers, change "G" in model number to "S" (no extra charge). Ordering Examples: PX5500L1-025A10E, 25 psi absolute transducer with 0 to 10 Vdc output, PTIH-10-6P electrical connection, and MS33656-4, male pressure port. PT06F10-6S-R, mating

connector (sold separately).

G¹/₄ **Pressure** Snubbers: PS-4G-MG = Gas PS-4E-MG = Lt Oil PS-4D-MG = Dense Liquid

PX5500C6-5KG5E, 5000 psi gage pressure transducer with 0 to 5 Vdc output, mini DIN electrical connection, and ¼-18 NPT male pressure port.

High-Performance Thin-Film Pressure Transducer

Metric Custom Configurations

PXM5500 PRESSURE ELECTRICAL SERIES PORT CONNECTION [1] [2] -	RANGE (BAR) [3]	UNITS [4]	OUTPUT OPTIONS [5] [6]
MA = G ¹ / ₈ B Male extra charge MB = G ¹ / ₈ B Female no charge MC = G ¹ / ₈ B Male extra charge MD = G ¹ / ₈ B Female no charge 0 = 0.6 m (2') cable (std) add cost per/meter over 0.6 m (2')	001BAR 1.60BAR 004BAR 006BAR 010BAR 016BAR 025BAR 040BAR	S,G,A S,G,A S,G,A S,G,A S,G,A S,G,A S,G,A S,G,A	5E = 0 to 5 Vdc CAL11 = 11-point calibration 10E = 0 to 10 Vdc certificate 5T* = 0 to 5 Vdc + cost * 5T is a legacy ()ft = Optional cable product and is not length in meters recommended for new designs.
 1 = PTIH-10-6P twist-lock connector (or equal, no charge). Mating connector (sold separately), order PT06F10-6S-R 6 = mini DIN connector (no charge) Visit us online for additional options including extended compensated temperatures. 	060BAR 100BAR 160BAR 250BAR 400BAR 600BAR	S,G,A S,G,A S,G,A S,G,A S,G,A S,G,A	 To order a custom configuration: 1. Select a pressure port 2. Select electrical connection 3. Select a pressure range 4. Select pressure units – Sealed Gage, Gage or Absolute 5. Select output 6. Select options

Popular Metric Models with 0 to 5 or 0 to 10 Vdc Output Shown Below (See Custom Configurations Section for All Available Versions/Options)

Pressur	e Range	Model N	o. (With Output Termination Style)				
Metric	Imperial	0.6 m (2') Cable	PTIH-10-6P Connector	mini DIN Connector			
Gage Pressure (All Ranges Also Available in Absolute and Sealed Gage Pressure, See Below)							
0 to 1 bar	0 to 15 psi	PXM5500M[*]0-001BARG[**]	PXM5500M[*]1-001BARG[**]	PXM5500M[*]6-001BARG[**]			
0 to 1.60 bar	0 to 23 psi	PXM5500M[*]0-1.60BARG[**]	PXM5500M[*]1-1.60BARG[**]	PXM5500M[*]6-1.60BARG[**]			
0 to 4 bar	0 to 58 psi	PXM5500M[*]0-004BARG[**]	PXM5500M[*]1-004BARG[**]	PXM5500M[*]6-004BARG[**]			
0 to 6 bar	0 to 87 psi	PXM5500M[*]0-006BARG[**]	PXM5500M[*]1-006BARG[**]	PXM5500M[*]6-006BARG[**]			
0 to 10 bar	0 to 145 psi	PXM5500M[*]0-010BARG[**]	PXM5500M[*]1-010BARG[**]	PXM5500M[*]6-010BARG[**]			
0 to 16 bar	0 to 232 psi	PXM5500M[*]0-016BARG[**]	PXM5500M[*]1-016BARG[**]	PXM5500M[*]6-016BARG[**]			
0 to 25 bar	0 to 363 psi	PXM5500M[*]0-025BARG[**]	PXM5500M[*]1-025BARG[**]	PXM5500M[*]6-025BARG[**]			
0 to 40 bar	0 to 580 psi	PXM5500M[*]0-040BARG[**]	PXM5500M[*]1-040BARG[**]	PXM5500M[*]6-040BARG[**]			
0 to 60 bar	0 to 870 psi	PXM5500M[*]0-060BARG[**]	PXM5500M[*]1-060BARG[**]	PXM5500M[*]6-060BARG[**]			
0 to 100 bar	0 to 1450 psi	PXM5500M[*]0-100BARG[**]	PXM5500M[*]1-100BARG[**]	PXM5500M[*]6-100BARG[**]			
0 to 160 bar	0 to 2321 psi	PXM5500M[*]0-160BARG[**]	PXM5500M[*]1-160BARG[**]	PXM5500M[*]6-160BARG[**]			
0 to 250 bar	0 to 3626 psi	PXM5500M[*]0-250BARG[**]	PXM5500M[*]1-250BARG[**]	PXM5500M[*]6-250BARG[**]			
0 to 400 bar	0 to 5802 psi	PXM5500M[*]0-400BARG[**]	PXM5500M[*]1-400BARG[**]	PXM5500M[*]6-400BARG[**]			
0 to 600 bar	0 to 8702 psi	PXM5500M[*]0-600BARG[**]	PXM5500M[*]1-600BARG[**]	PXM5500M[*]6-600BARG[**]			

Comes complete with 5-point NIST-traceable calibration. Visit us online for compatible meters.

[*] Pressure Port (see Custom Configurations section and enter MA, MB, MC, or MD).

[**] Output Voltage Range: Enter "5E" for 0 to 5 Vdc output, or "10E" for 0 to 10 Vdc output.

To order absolute pressure models, replace "G" in model number with "A" (no extra charge).

To order sealed gage models, replace "G" in model number with "S" (no extra charge).

Ordering Examples: PXM5500MC6-060BARS5E, 60 bar sealed gage transducer with 0 to 5 Vdc output, mini DIN electrical connection and G¹/₄ male pressure port. Mating connector included.

PXM5500MC0-010BARA10E, 10 bar absolute pressure transducer with 0 to 10 Vdc output, 0.6 m (2') cable connection and G¹/₄ male pressure port.

Accessories

Model No.	Description
PT06F10-6S-R	Mating connector for PX5500/PXM5500 Series units with PTIH-10-6P twist-lock connector

B-215

HIGH-PERFORMANCE THIN-FILM TRANSMITTER STANDARD AND METRIC MODELS

4 to 20 mA Output 0-15 to 0-10,000 psi-Standard Models 0-1 to 0-600 bar-Metric Models

1 bar = 14.5 psi $1 \text{ kg/cm}^2 = 14.22 \text{ psi}$ 1 atmosphere = 14.7 psi = 29.93 inHg = 760.2 mmHg = 1.014 bar

PX5500/PXM5500 Series

F Rohs

- ✓ High 0.1% Accuracy
- Solid State Reliability
- Sputtered Strain Gage Design
- High Shock and Vibration Resistance
- Low Drift

NIST

Standard

✓ 5-Point NIST **Calibration Standard**

Applications


- Testing
- R&D/Engineering Test Laboratories
- Functional Test Systems
- Production Testing
- Product Quality Assurance
- Flight Testing
- Gas Turbine and Engine **Test Standards**
- Ground Support Equipment
- Hydraulic Systems
- Custody Transfer Measurements

transducer series provides high performance in demanding industrial and research applications where accuracy, reliability, and price are important. These transducers have a 10-year MTBF rate and are stable to 0.1% of FS over an 18-month period. This translates into less downtime, fewer test reruns, more time between calibrations, and more reliable pressure data. When recalibration is impossible, relying on the high stability of a PX5500/ PXM5500 transducer may be the only cost-effective way to obtain pressure data over the long term. OMEGA's thin-film technology makes this premium performance possible. The strain gages and associated structures are sputterdeposited directly onto the pressure sensing element, thus eliminating the need for adhesives. The resulting molecular bond between the sensing element and the strain gages ensures virtually no shifting, drifting, or "creep" in the performance of the transducer. The micro-geometry design of the PX5500/PXM5500 sensing element results in a very small, low-mass sensor that reduces effects of mechanical vibration and shock. The PX5500/PXM5500 delivers accuracy, reliability, and stability at competitive prices.

OMEGA's PX5500/PXM5500

SPECIFICATIONS mA Models

Excitation: 10 to 40 Vdc unregulated, reverse polarity protected Output (FS): 4 to 20 mA ±0.8 mA adj Zero Balance: 4 mA ±0.4 mA adj Input Current: 20 mA max with no load

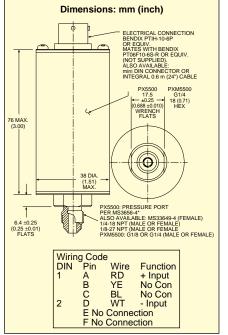

TANDARD PX5500L1-100GI, shown actual size.

Twist-lock style.

Load Impedance: 50 (V – 10) Ω max where V is supply voltage (40 Vdc max) **Insulation Resistance:** 100MΩ at 50Vdc between all pins

shorted together and case **Electrostatic Discharge:**

Protected to 15 kV max

Sensing Element:

4-active-arm bridge using sputterdeposited thin-film elements

Accuracy (Combined Linearity, Hysteresis and Repeatability): ±0.10% FS (BFSL) <1000 psi ±0.15% FS 1000 psi and above

Vibration Sensitivity: At 20 g peak sinusoidal vibration from 10 to 2000 Hz (½" D.A.), the output shall not exceed 0.04% FS/g for 15 psi range, decreasing to 0.003% FS/g for 1000 psi and above

Natural Frequency: 5 kHz for 15 psi, increasing logarithmically to 50 kHz for 5000 psi

SPUTTERED SILICON TECHNOLOGY

Shock: Qualification level of 100 g. 11 ms half sine wave without damage Operating Temp Range: -40 to 85°C (-40 to 185°F) **Compensated Temp Range:** -18 to 82°C (0 to 180°F) Thermal Effects (Over the Compensated Range):

Span: ±0.02% FS/°F Zero: ±0.02% FS/°F Proof Pressure: 2 times rated pressure or 15,000 psi, whichever is less, will not cause changes in performance beyond the specified tolerance

Burst Pressure: 3 times rated pressure or 20,000 psi, whichever is less, will not cause rupture of the pressure containment cavity Wetted Parts:

17-4 PH or 15-5 PH stainless steel

Pressure Port: See dimensional drawings on page B-215 Electrical Connection: PTIH-10-6P standard

Mating Connector: PT06F10-6S-R (sold separately)

Weight: 225 g (8 oz) maximum

STANDARD CUSTOM CONFIGURATIONS

PX5500 PRESSURE SERIES PORT [1]	ELECTRICAL CONNECTION [2]	RANGE (psi) [3]	UNITS [4]	OUTPUT [5]	OPTIONS [6]
A = ½-27 NPT male B = ½-27 NPT female C = ½-18 NPT male D = ¼-18 NPT female L = MS33656-4 M = MS33649-4	-	015 025 050 100 250 500 1K	A, G, S A, GG, S A, GG, S A, GG, S A, GG, S A, G, S	Base Price PX5500 I = 4 to 20 mA	CAL11 = 11-pt cal + cost ()ft = Optional cable length in feet
add c 1 = PTIH- (or ec Matin (sold PT06	(2') cable cost per/ft over 0.6 -10-6P connector qual, no charge). Ig connector separately), order 5F10-6S-R DIN connector	1.5K	A, G, S A, G, S A, G, S A, G, S A, G, S A, G, S	 To order a custom 1. Select a pressur 2. Select electrical 3. Select a pressure 4. Select pressure Gage or Sealed 5. Select output 6. Select options a 	re port connection re range units – Absolute,

Ordering Examples: PX5500A1-015AV, v/8-27 NPT male pressure port, twist-lock connector, 15 psi absolute pressure range and mV/V output. PT06F10-6S-R, mating connector (sold separately). PX5500M1-10KG5T, MS33649-4 female pressure port, twist-lock connector, 10,000 psi gage pressure range and 0 to 5 Vdc output. **PT06F10-6S-R**, mating connector (sold separately). **PX5500L0-015AI-25FT**, MS33656-4 male pressure port, 8 m (25') lead wire, 15 psi absolute pressure range and 4 to 20mA output.

METRIC CUSTOM CONFIGURATIONS

PXM5500 SERIESPRESSURE PORTELECTRICAL CONNECTION[1][2]MA = G%B Male cost[2]MB = G%B Female no charge[3]MC = G%B Male cost[3]MD = G%B Female no charge[3]0 = 0.6 m (2') cable (std)	RANGE (BAR) [3] 1.0 1.6 4.0 6.0 10 10 16 25	A, G, S F A, G, S I A, G, S I A, G, S A, G, S	OUTPUT [5] Base price XM5500 = 4 to 20 mA	OPTIONS [6] CAL11 = 11-point calibration certificate ()m = Optional cable length in meters
add cost per/m over 0.2 m (2 1 = PTIH-10-6P connector (or equal, no charge) 6 = mini DIN connector	2') 25 40 60 100 160 250 400 600	Â, Â	 Select a p Select ele Select a p Select pre Gage or S 	custom configuration: pressure port ectrical connection pressure range essure units – Absolute, Sealed gage
Visit us online for additional options includ extended compensated temperatures.	ling		 Select ou Select op 	tput tions and agency approvals

Ordering Examples: PXM5500MB0-010BARS5T, 10 bar sealed gage pressure transducer with G¹/₆B female connection and 0.6 m (2') cable termination.

PXM5500MD1-010BARA5T, 10 bar absolute pressure transducer with Gr/4B temale connection and twist-lock connector. PT06F10-6S-R, mating connector (sold separately).

Twist-lock style.

STANDARD MODELS

To Order					
Models with 4 to 20 mA Output, MS33656-4 Connection, Twist-Lock Connector					
RANGE		MODEL NO.	COMPATIBLE METERS*		
Absolute Pressure (All Ranges Available in Absolute Pressure)					
0 to 15 psi	0 to 1.0 bar	PX5500L[*]-015AI	DP41-E, DP25B-E, DP24-E		
0 to 25 psi	0 to 1.7 bar	PX5500L[*]-025AI	DP41-E, DP25B-E, DP24-E		
0 to 50 psi	0 to 3.4 bar	PX5500L[*]-050AI	DP41-E, DP25B-E, DP24-E		
0 to 100 psi	0 to 6.9 bar	PX5500L[*]-100AI	DP41-E, DP25B-E, DP24-E		
Gage Pressure (All Ranges Also Available in Sealed Gage Pressure)					
0 to 15 psi	0 to 1.0 bar	PX5500L[*]-015GI	DP41-E, DP25B-E, DP24-E		
0 to 25 psi	0 to 1.7 bar	PX5500L[*]-025GI	DP41-E, DP25B-E, DP24-E		
0 to 50 psi	0 to 3.4 bar	PX5500L[*]-050GI	DP41-E, DP25B-E, DP24-E		
0 to 100 psi	0 to 6.9 bar	PX5500L[*]-100GI	DP41-E, DP25B-E, DP24-E		
0 to 250 psi	0 to 17.2 bar	PX5500L[*]-250GI	DP41-E, DP25B-E, DP24-E		
0 to 500 psi	0 to 34.5 bar	PX5500L[*]-500GI	DP41-E, DP25B-E, DP24-E		
0 to 1000 psi	0 to 68.9 bar	PX5500L[*]-1KGI	DP41-E, DP25B-E, DP24-E		
0 to 1500 psi	0 to 103 bar	PX5500L[*]-1.5KGI	DP41-E, DP25B-E, DP24-E		
0 to 2500 psi	0 to 172 bar	PX5500L[*]-2.5KGI	DP41-E, DP25B-E, DP24-E		
0 to 3000 psi	0 to 207 bar	PX5500L[*]-3KGI	DP41-E, DP25B-E, DP24-E		
0 to 5000 psi	0 to 345 bar	PX5500L[*]-5KGI	DP41-E, DP25B-E, DP24-E		
0 to 10,000 psi	0 to 689 bar	PX5500L[*]-10KGI	DP41-E, DP25B-E, DP24-E		

Comes complete with 5-point NIST traceable calibration.

* Visit us online for compatible meters.

[*] = Insert "0" for 0.6 m (2') cable, "1" for twist-lock connector, or "6" for mini DIN connector. To order absolute pressure models, change "G" in model number to "A" (no extra charge). To order sealed gage models, change "G" in model number to "S" (no extra charge). Ordering Examples: PX5500L1-1KSI, 1000 psi sealed gage transducer with 4 to 20 mA output, PTIH-10-6P electrical connector and MS33656-4, male pressure port.

PT06F10-6S-R, mating connector (sold separately).

PX5500L1-100AI, 100 psi absolute pressure transducer with 4 to 20 mA output, PTIH-10-6P electrical connector and MS33656-4, male pressure port. PT06F10-6S-R, mating connector (sold separately).

METRIC MODELS

Models with G ¼ Male Pressure Connection, Cable or Connector and 4 to 20 mA Output					
ε	MODEL NO.	COMPATIBLE METERS*			
GAGE PRESSURE					
0 to 15 psi	PXM5500MC[*]-001BARGI	DP41-E, DP25B-E, DP24-E			
0 to 23 psi	PXM5500MC[*]-1.60BARGI	DP41-E, DP25B-E, DP24-E			
0 to 58 psi	PXM5500MC[*]-004BARGI	DP41-E, DP25B-E, DP24-E			
0 to 87 psi	PXM5500MC[*]-006BARGI	DP41-E, DP25B-E, DP24-E			
0 to 145 psi	PXM5500MC[*]-010BARGI	DP41-E, DP25B-E, DP24-E			
0 to 232 psi	PXM5500MC[*]-016BARGI	DP41-E, DP25B-E, DP24-E			
0 to 363 psi	PXM5500MC[*]-025BARGI	DP41-E, DP25B-E, DP24-E			
0 to 580 psi	PXM5500MC[*]-040BARGI	DP41-E, DP25B-E, DP24-E			
0 to 870 psi	PXM5500MC[*]-060BARGI	DP41-E, DP25B-E, DP24-E			
0 to 1450 psi	PXM5500MC[*]-100BARGI	DP41-E, DP25B-E, DP24-E			
0 to 2321 psi	PXM5500MC[*]-160BARGI	DP41-E, DP25B-E, DP24-E			
0 to 3626 psi	PXM5500MC[*]-250BARGI	DP41-E, DP25B-E, DP24-E			
0 to 5802 psi	PXM5500MC[*]-400BARGI	DP41-E, DP25B-E, DP24-E			
0 to 8702 psi	PXM5500MC[*]-600BARGI	DP41-E, DP25B-E, DP24-E			
	E SURE 0 to 15 psi 0 to 23 psi 0 to 58 psi 0 to 758 psi 0 to 758 psi 0 to 145 psi 0 to 232 psi 0 to 363 psi 0 to 580 psi 0 to 580 psi 0 to 2321 psi 0 to 2321 psi 0 to 3626 psi 0 to 5802 psi 0 to 8702 psi	E MODEL NO. SURE 9XM5500MC[*]-001BARGI 0 to 15 psi PXM5500MC[*]-001BARGI 0 to 23 psi PXM5500MC[*]-1.60BARGI 0 to 23 psi PXM5500MC[*]-004BARGI 0 to 87 psi PXM5500MC[*]-006BARGI 0 to 145 psi PXM5500MC[*]-010BARGI 0 to 232 psi PXM5500MC[*]-016BARGI 0 to 232 psi PXM5500MC[*]-016BARGI 0 to 363 psi PXM5500MC[*]-040BARGI 0 to 580 psi PXM5500MC[*]-040BARGI 0 to 70 psi PXM5500MC[*]-040BARGI 0 to 1450 psi PXM5500MC[*]-100BARGI 0 to 2321 psi PXM5500MC[*]-100BARGI 0 to 3626 psi PXM5500MC[*]-400BARGI 0 to 5802 psi PXM5500MC[*]-400BARGI			


Comes complete with 5-point NIST traceable calibration.

* Visit us online for compatible meters.

[*] = Insert "0" for 0.6 m (2') cable, "1" for twist-lock connector, or "6" for mini DIN connector. To order absolute pressure models, replace "G" in model number with "A" (no extra charge). To order sealed gage models, replace "G" in model number with "S" (no extra charge). Ordering Examples: PXM5500MC0-060BARSI, 60 bar sealed gage transmitter with 4 to 20 mA output, 0.6 m (2') cable connection and G $\frac{1}{4}$ male pressure port. **PXM5500MC6-1.60BARAI,** 1.6 bar absolute pressure transmitter with 4 to 20 mA output, mini-DIN connection and G ¼ male pressure port. Mating connector included.

STANDARD PX5500L1-100GI, shown actual size.

Mating Connector PT06F10-6S-R



Tetter and the second sec	G¼ Pressure Snubbers:
	PS-4G-MG = Gas PS-4E-MG = Lt Oil
	PS-4D-MG = Dense
	Liquid

ACCESSORY

MODEL NO.	DESCRIPTION	
PT06F10-6S-R	Mating connector for PX5500 units with integral twist-lock connector	