Rugged Handheld **Environmental Meters**

With Rubber Bumper and Cover for Field Engineering

Temperature Measurement

Dual Input Type K Thermocouple Thermometer HHC201

- ✓ 0.1% Accuracy
- ✓ Fast Temperature Response
- ✓ Display T1, T2 or T1-D2 Differential
- ✓ Functions: Hold/Min/Max/Max-Min/AVG/REL
- ✓ Auto Power-Off (10 Minutes)
- ✓ Backlight with Auto-Off (15 Seconds)

Specifications

Units: °C or °F

Range: -200 to 1372°C (-328 to 2500°F)

Resolution:

0.1°: -100 to 1372°C (-148 to 2500°F) 1°: -200 to -100°C (-328 to -148°F)

Accuracy: Type K thermocouple ITS-90

±(0.1% rdg +1°C): -60 to 1372°C (-76 to 2500°F) \pm (0.1% rdg +2°C): -200 to -60°C (-328 to -76°F) Operating Temperature: 0 to 50°C (32 to 122°F)

Power: 2 "AAA" batteries (included)

Battery Life: 250 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 148 g (5.2 oz)

Comes complete with batteries, carrying strap, protection cap, and thermocouple.

Infrared Thermometer

HHC210

- Laser Sighting
- ✓ Field of View 6:1
- Adjustable Emissivity 0.1 to 1.00
- **✓** Display IR Temperature, Ambient Temperature and IR-Ambient Differential Temperature
- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- Auto Power-Off (10 Minutes)
- Backlight with Auto-Off (15 Seconds)

Specifications

Units: °C or °F

Infrared Temperature:

FOV: 100 mm (4") @ 600 mm (24") Range: -30 to 550°C (-22 to 1022°F)

Resolution: 0.1°

±2°C: -30 to 100°C (-22 to 212°F) ±2% rdg: 101 to 550°C (214 to 1022°F)


Air Temperature:

Range: -20 to 60°C (-4 to 140°F)





HHC210 shown smaller than actual size.

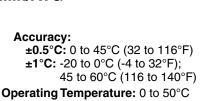

(32 to 122°F)

Power: 2 "AAA" batteries (included) Battery Life: 40 hour with laser typical with alkaline batteries

Dimensions: 24.7 x 50.9 x 132.9 mm

(0.98 x 2.0 x 5.2") Weight: 148 g (5.2 oz)

Comes complete with batteries, carrying strap, and protection cap.





1 YEAR



Pressure Measurement





HHC280 shown smaller than actual size.



High Accuracy Absolute Pressure Measurement

- **✓** Barometric and Altitude Measurement
- Calculation of Barometric Pressure
- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- Auto Power-Off (10 Minutes)
- ✓ Backlight with Auto-Off (15 Seconds)

Specifications

Eight Selectable Units: hPa, mbar, Pa, mmH₂O, mmHg,

inH₂O, inHg, psi, plus m and ft (for altitude)

Range: 300 to 1200 hPa Resolution: 0.1 hPa Accuracy: ±3 hPa

Operating Temperature: 0 to 50°C (32 to 122°F)

Power: 2 "AAA" batteries (included)

Battery Life: 600 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 120 g (4.2 oz)

Comes complete with batteries, carrying strap, and protection cap.

Unit	Range	Resolution
mmH₂O	0 to 1019.7	0.1
mmHg	0 to 75.00	0.01
psi	0 to 1.450	0.001
inH₂O	0 to 40.14	0.01
inHg	0 to 2953	0.001
hPa	0 to 100.00	0.01
mbar	0 to 100.00	0.01
Pa	0 to 10000	1
FPM	*	1
m/s	*	0.1

Differential Manometer

HHC280

- ✓ 0 to 40 inH₂O/0 to 100 hPa
- HVAC System Troubleshooting
- ✓ Gas Pressure Measurements
- Compliant for Pitot Tubes for Measuring Air Velocity
- ✓ Dual Inputs P1 and P2
- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- Auto Power-Off (10 Minutes)
- ✓ Backlight with Auto-Off (15 Seconds)

Specifications

Eight Selectable Units: mmH₂O, mmHg, psi, inH₂O, inHg,

hPa, mbar, Pa, plus m/s and fmp (for air velocity)

Range: 0 to 100 hPa/0 to 1019.7 mmH_2O

Resolution: 0.1 hPa/0.1 mmH₂O Accuracy: ±0.03 hPa (0 to 0.30 hPa)

±0.05 hPa (0.31 to 1.00 hPa)

 $\pm 0.1 \text{ hPa} + 1.5\% \text{ or rdg (rest of range)} \\ \pm 0.3 \text{ mmH}_2\text{O} \text{ (0 to } 3.0 \text{ mmH}_2\text{O)} \\ \pm 0.5 \text{ mmH}_2\text{O} \text{ (3.1 to } 10.2 \text{ mmH}_2\text{O)}$

±1.02 mmH₂O + 1.5% of rdg (rest of range)

Operating Temperature: 0 to 50°C (32 to 122°F)

Power: 2 "AAA" batteries (included)

Battery Life: 85 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 113 g (4.0 oz)

Comes complete with batteries, carrying strap, and protection cap.





HHC281 shown smaller than actual size.

RPM/Light Measurement

Light Meter

HHC230

- Measures Light Intensity
- ✓ Wide Measuring Range 0 to 200,000 lux
- ✓ Spectral Response f<8%</p>
- ✓ Based on CIE Standard Illuminant A (2856K)

1 YEAR

- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- ✓ Auto Power Off (10 Minutes)
- ✓ Backlight with Auto-Off (15 Seconds)

Specifications

Range: 0 to 200,000 lux; 0 to 18,580 fc

Accuracy: ±3% rdg + 10 digits (based on a light source 2856K)

Resolution: 1 lux (0 to 19999), 10 lux (20,000 to 200,000), 1 fc (0 to 18,580)

Operating Temperature: 0 to 50°C (32 to 122°F)

Typical Light Intensity Ranges (lux): Design/General Office: 1500 to 2000

Meeting Room: 300 to 750 Precision Assembly: 1500 to 3000 **R&D Department:** 750 to 1500

Packing/Measurement/Hallway: 300 to 750

Power: 2 "AAA" batteries (included)

Battery Life: 180 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 116 g (4.0 oz)

Comes complete with batteries, carrying strap, and protection cap.



HHC230 shown smaller than actual size.

RPM Meter

HHC250

- ✓ Non-Contact Optical RPM Measurement
- ✓ Wide Measuring Range up to 99999 rpm with **LED Spot Marking and Reflective Tape on Object**
- ✓ Measuring Range Up to 40 cm (15.7") (Depending on Ambient Light)
- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- Auto Power-Off (10 Minutes)
- Backlight with Auto-Off (15 Seconds)

Specifications

Range: 100.0 to 99999

Accuracy: ±0.02% of rdg + 1 digit

Resolution:

0.1 rpm: 100.1 to 19999.9 rpm **0.1 rps:** 1.7 to 333.3 rps 1 rpm: 20,000 to 99,999 **1 rps:** 334 to 1666 rps

Units: rpm/rps

Operating Temperature: 0 to 50°C (32 to 122°F)

Power: 2 "AAA" batteries (included)

Battery Life: 30 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 110 g (3.9 oz)

Comes complete with batteries, carrying strap, protection cap, and reflective tape (5 each).



smaller than

actual size.





Air Flow/Humidity/Dew Point/Wet Bulb

Hygro-Anemometer

HHC261

- ✓ 0.4 to 20 m/s (80 to 4000 ft/min)
- ✓ High Accuracy Air Flow Measurement
- Built-In Ambient Temperature Measurement
- ✓ Wind Chill Temperature (WCT) Indicator
- ✓ Integrated Flow Vane
- Humidity with Dew Point and Wet Bulb
- ✓ Functions: Hold/Min/Max/Max-Min/AVG
- Auto Power-Off (10 Minutes)
- ✓ Backlight with Auto-Off (15 Seconds)

Specifications

Air Velocity:

Range: 0.4 to 20 m/s (80 to 4000 ft/min)

Accuracy: ± 0.2 m/s + 2% of rdg; ± 0.40 ft/min + 2% of rdg

Resolution: 0.1 m/s, 1 ft/min

Units: beau, m/s, ft/m, mph, km/h, WCT, kts

Air Temperature:

Range: -20 to 60°C (-4 to 140°F)

Accuracy:

±0.5°C: 0 to 45°C (32 to 113°F) ±1°C: -20 to 0°C and 45 to 60°C (-4 to 32°F) and (113 to 140°F)

Resolution: 0.1°C/°F

Humidity:

Range: 0 to 100% RH

Accuracy:

±2.5%: 10 to 90% RH

±5%: 0 to 10% RH and 90 to 100% RH

Operating Temperature: 0 to 50°C (32 to 122°F)

1 YEAR CE



HHC261 shown smaller than actual size.

Power: 2 "AAA" batteries (included)

Battery Life: 50 hours typical with alkaline batteries **Dimensions:** 24.7 x 50.9 x 132.9 mm (0.98 x 2.0 x 5.2")

Weight: 119 g (4.2 oz)

Comes complete with batteries, carrying strap, and protection cap.

All Models Include Slip-Off Hard Cover Shell

